



ELECTROLUX HOME PRODUCTS PTY LTD

ABN 51 004 762 341

Technical Bulletin N° CEB040.doc

Issue: 1

Date: 1/08

WEB SITE ADDRESS: www.partnship.com.au

CERAMIC COOKTOP ERROR CODES

MODELS AFFECTED: PHL768 PHL798 EHET66AS EHET96AS

Error Code	Error / Cause	Solution
E-0	Programming error.	Replace powerboard.
E-5	Internal error.	Replace powerboard.
E-6	12VDC missing Communication error on internal bus.	Replace powerboard.
E-8	No communication to power board.) Error detected by HIC: Alarm displayed and after 10 sec went into reset. b) Error detected by hob controller: Alarm procedure as described above.	Replace interface harness.
E-9	Invalid configuration data (checked by HUI)	Replace powerboard.
E-	Too high light brightness on sensors: (Sun or lighting.)	Shade controls for a short time then re-assess.